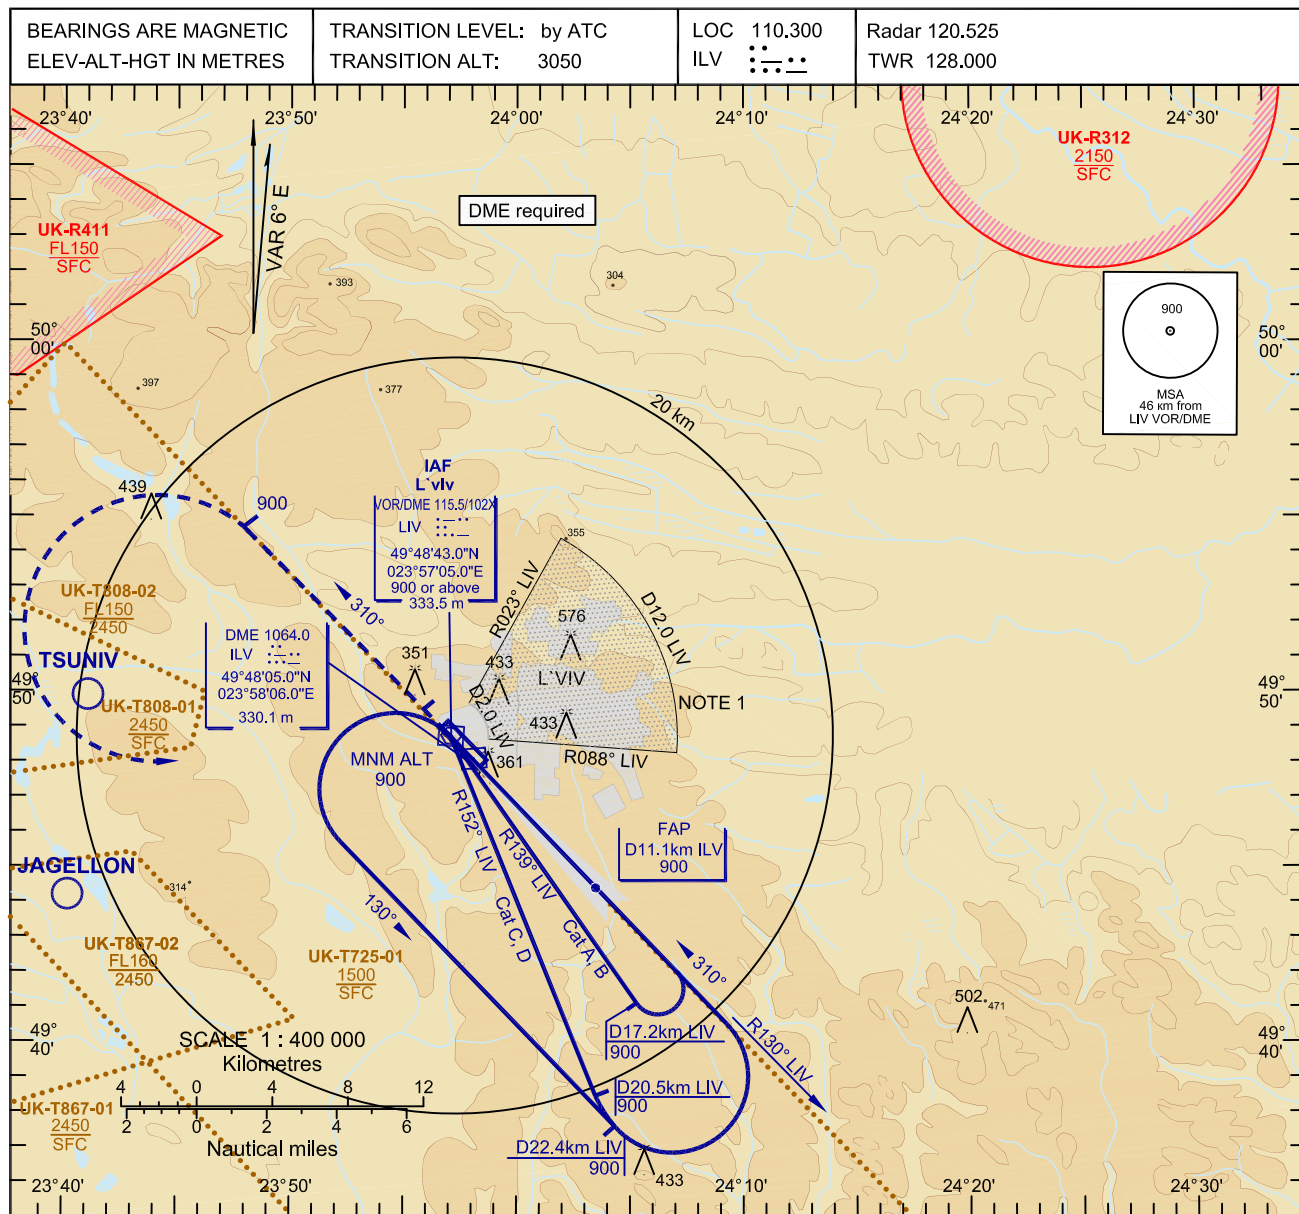


INSTRUMENT
APPROACH CHART (IAC)-ICAO

AD ELEV 328 m


L'VIV
ILS RWY 31

MISSED APPROACH RADIO COMM FAILURE:

Climb on track 310° to 900(575), turn LEFT
climbing 1200(875) to LIV VOR/DME,
HOLD OVER 5 min, then according to chart.

MISSED APPROACH:

Climb on track 310° to 900(575),
turn LEFT to LIV VOR/DME,
then according to chart or as directed by ATC.

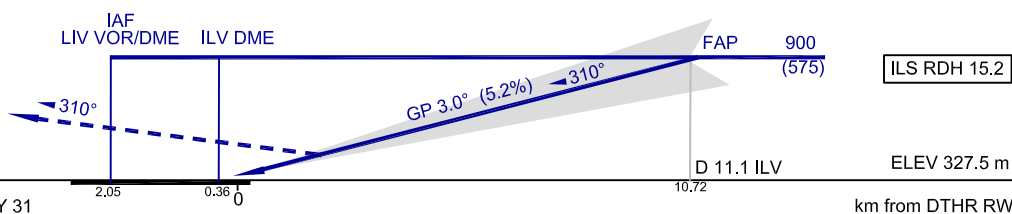

OCA/H		A	B	C	D	NOTE: 1. All flights in the sector below 900m not authorized.				
Straight-in Approach										
	ILS CAT I	401(74)	404(77)	407(80)	410(83)					
Circling		525(195)	525(195)	700(370)	700(370)					
GROUND SPEED		km/h	150	180	210	240	270	300	330	360
FAP - DTHR 10719 m		min:s	4.17	3.34	3.04	2.41	2.23	2.09	1.57	1.47
RATE OF DESCENT		m/s	2.2	2.6	3.1	3.5	3.9	4.4	4.8	5.2